

APPLICATION INSTRUCTIONS

For product description refer to the product data sheet

HEMPEL'S GALVOSIL* 15700

Scope:

These application instructions cover surface preparation, application equipment, and application of HEMPEL'S GALVOSIL 1570.

The following are general rules, which may be supplemented with more detailed descriptions when needed, for instance for major newbuildings/new constructions or extensive repair jobs.

Steel work:

All welds must be free of pinholes and must be of highest quality so that they can be protected by the paint. This means perfectly filled, smooth welds with a slightly wavy surface.

All welds must be complete and continuous which will otherwise cause coating discontinuity.

All weld spatters must be removed.

All sharp edges must be removed or rounded off in such a way that the specified film thickness can be build-up on all surfaces. Recommended radius of the rounding is approximately 1-2 mm.

The steel must be of first class quality and should not have been allowed to rust more than corresponding to grade B of ISO 8501-1:1988.

Note: Porous surfaces such as certain types of cast iron cannot be properly protected with zinc silicate. Deeply corroded steel may also be difficult to protect with a zinc silicate.

All steel work (including welding, flamecutting, grinding) must be finished before the surface preparation starts.

Surface preparation:

Prior to abrasive blast cleaning of the steel, remove oil, grease, salts and other contamination with a suitable detergent followed by high pressure fresh water hosing. Alkali deposits on new welding seams as well as soap traces from pressure testing of tanks to be removed by fresh water and scrubbing with stiff brushes. Control for absence of contamination according to separate guidelines.

On repair jobs, a rough blasting to remove all loosely adhering materials may be required before degreasing/washing is carried out.

Old steel: Even after a very thorough tank cleaning, pits may typically contain contamination in the form of remnants of old cargoes as well as water soluble salts. For this reason, repeated detergent washing plus abrasive blasting may be necessary.

After the first blasting a very thorough vacuum cleaning is carried out in order to see if any "cargo bleeding" occurs as well as controls for water soluble salts are made. Reference is made to separate instructions. Special care should be taken in evaluating pitted areas.

Grit blast to min Sa 2½, ISO 8501-1:1988, SSPC-SP-10.

To obtain full chemical resistance according to the CARGO PROTECTION GUIDE, the steel surface must be abrasive blast cleaned according to ISO 8501-1:1988, very near to white metal Sa 2½ (SSPC-SP-10)-Sa 3 (SSPC-SP-5). In practice, this requirement is to be understood as white metal Sa 3 at the moment of abrasive blasting, but allows for a slight reduction at the moment of paint application.

The resulting surface profile must be equivalent to Rugotest No. 3, min. BN 10a, Keane-Tator Surface Comparator, G/S min 3.0 or ISO/DIS 8503/1 rough MEDIUM (G).

Note: A lower surface profile than specified will cause reduced adhesion and increased tendency to mud cracking.

Use steel grit, silica sand, aluminium silicate, or similar sharp edged abrasives of a good quality free of foreign matters, soft particles, and the like. Control for absence of contamination according to separate guidelines.

Steel grit with particle sizes of 0.2-1.2 mm or aluminium silicate of 0.4-1.8 mm will usually create the desired surface profile when the air pressure measured at the nozzle is 6-7 bar/85-100 psi.

The compressed air must be dry and clean. The compressor must be fitted with suitable oil and water traps.

When the abrasive blasting is completed, remove residual grit and dust by vacuum cleaning. Abrasive particles not removed by vacuum cleaning are to be removed by brushing with clean brushes followed by vacuum cleaning.

The importance of systematic working must be stressed when blasting. Poorly blasted areas covered with dust are very difficult to locate during the blast inspection made after the rough cleaning.

Old tank coatings: Must be completely removed. If the steel is pit corroded, the above guidelines for "Old steel" must be followed.

Shopprimed surfaces: When shoppriming is required only zinc silicate shopprimer such as HEMPEL'S SHOPPRIMER ZS 1572 may be used and preferably in a reddish shade.

Before recoating with GALVOSIL 1570, intact shopprimer must be abrasive grit swept followed by vacuum cleaning to remove accumulated dirt and zinc salts and to ensure adhesion.

Welds, rusty spots, burned areas, and all areas with other types of shopprimers than zinc silicates of a type like HEMPEL'S SHOPPRIMER ZS 1572 must be completely abrasive grit blasted as described above.

Application equipment:

GALVOSIL 1570 can be applied by conventional spray equipment (pressure pot type), airless spray equipment, or by brush.

Conventional Spray equipment: Standard industrial spray equipment with mechanical agitator and pressure regulators, air filters, and water traps.

Air hose: 10 mm (3/8") internal diameter.
Material hose: 13 mm (1/2") internal diameter.

Hoses should be as short as possible, preferably not longer than 10 metres/30 feet.

Pot pressure: 2.5-5 bar (35-70 psi)
Atomization pressure: 1.5-2.5 bar (20-35 psi)
Nozzle orifice: 1.8-2.2 mm (.070"-.085")

(Spray-data are indicative and subject to adjustment).

Thinning, if required: max. 50% of THINNER 0870.

The pressure pot must be placed at the same level as or at a higher level than the spray gun when spraying, owing to the weight of the material. Alternatively a piston-pump (e.g. 10:1) may be used instead of the pressure pot. This will facilitate the use of longer hoses or having the spray gun at a higher level than the pump.

When painting undersides, the spray gun will need intermittent cleaning with THINNER 0870 to prevent clogging of the nozzle.

With conventional spray application regulation of the pot and the atomizing air pressures can be made as follows:

1. Shut off the atomizing air.
2. Regulate the pressure in the pot so that the material reaches approximately 60 cm/20" horizontally out from the gun before falling to the ground.
3. Turn on the atomizing air using lowest possible pressure.

Airless spray equipment: A large, slow-working pump is preferred, e.g 30:1, with a pump capacity of 8-12 litres/minute. The in-line filter should be 60 mesh.

Gaskets:	Teflon
Nozzle orifice:	.019" through .023".
Fan angle:	40° through 70°.
Nozzle pressure:	100-150 bar (1400-2100 psi).

(Spray data are indicative and subject to adjustment).

Thinning, if required: max. 30% of THINNER 0870.

Thinning:

The amount of thinning necessary will depend upon prevailing conditions: Temperature, humidity, wind/ventilation, method of spraying, spray equipment, etc.

In the case of a high level of thinning and/or long stops in application, the mixed paint must be recirculated to avoid settlement of zinc particles in the spray hoses.

The coating **must** be wet and smooth just after application. Besides correct spray technique, the amount of thinner added must be selected securing this optimum film formation.

Too little thinning will typically lead to dry-spray and too much thinning to sagging and settling of zinc particles in the can.

Cleaning of equipment:

The whole equipment must be cleaned thoroughly with THINNER 0870 after use.

Additionally for conventional spray-guns:

In the case of short stops, prevent packing of zinc around the needle by placing the spray gun in THINNER 0870 and let some air pass the spray gun. In the case of longer stops, clean the spray gun with THINNER 0870.

Mixing:

- a. Do not open packings until immediately before use. The entire content of the two packings must be used for each batch to ensure a correct mixture. Left-overs in the packings cannot be used later. Protect the ZINC DUST against moisture before mixing.
- b. Before mixing, shake or stir the GALVOSIL 1570 LIQUID very thoroughly.
- c. Pour the ZINC DUST slowly down into the LIQUID with constant mechanical stirring. **Do not mix in the reverse order.** Continue stirring until the mixture is free of lumps.
- d. Strain the mixture through a screen, 60 - 80 mesh (250 - 160 DIN Norm. 4188).

Pot life:

8 hours at 20°C/68°F.

Temperature of paint:

In a hot climate it is important that the cans with LIQUID are kept out of the sun and that the temperature of the liquid is kept below 30°C/86°F in order to avoid excessive dry spray.

Issued:

September 1997/15700 - Page 3 of 8

**Application procedure,
general:**

Maintain constant agitation of the mixture until the batch is depleted.

The spray gun should be kept at a distance of 30-50 cm from the surface. Hold the spray gun at a right angle to the surface, making even, parallel passes with about 50% overlap.

Besides correct spray technique the amount of thinner added must be carefully adjusted to secure optimum film formation. **The coating must be wet and smooth just after application. It is important to avoid dry-spraying.**

Select small nozzles (small orifice and small fan angle) for spray application of complicated structures, while bigger nozzles may be used for regular surfaces.

The wet film thickness must be checked immediately after application, but it can only be used as a rough guidance because of the fast drying.

**Application procedure,
tank coating:**

When used as a tank coating, HEMPEL'S GALVOSIL 1570 is normally specified in 1 x 100 micron/1 x 4 mils - minimum 80 micron/3.2 mils, maximum 150 micron/6 mils.

To achieve a correct film formation within these limits, it is recommended to apply two coats "wet-in-almost-dry":

Apply one coat and apply the second coat within 15-30 minutes before the first coat has turned grey but is still dark.

When following this procedure, HEMPEL'S GALVOSIL 1570 must be thinned approximately 15% in order to avoid too high film thicknesses.

Too high film thicknesses on welds in corners must be smoothened by a flat brush, approximately 1" wide.

When coating tanks, it is of the utmost importance to avoid dry-spray, which is a typical indication of poor film formation.

Poor film formation of a one-coat tank coating system like HEMPEL'S GALVOSIL 1570 in 1 x 100 micron/1 x 4 mils may result in immediate failure.

Any dry-sprayed areas must be smoothened by scraping with a spatula or by light sandpapering.

After vacuum cleaning as necessary, the smoothened areas are applied a thin coat of HEMPEL'S GALVOSIL 1570 achieved by using 20-25% thinning.

Note: If working conditions ask for it some hours may elapse between the first and the second coat provided that the relative humidity is kept constantly low, but it is recommended to finalize the application as soon as possible and within the same working shift.

Stripe coating:

All places difficult to cover properly by spray application must be stripe coated with a brush immediately before or after the spray application

Microclimate:

The actual climatic conditions at the substrate during application and until acceptance:

The minimum surface temperature is -10°C/14°F.

The maximum recommended surface temperature is approx. 40°C/104°F. Higher steel temperatures are acceptable provided dry-spray is avoided by (extra thinning and) proper spray application. In extreme cases a reduction of the dry film thickness may also be necessary. In a warm climate it is recommended to carry out application during nighttime.

The steel temperature must be above the dewpoint. As a rule of thumb a steel temperature which is 3°C/5°F above the dewpoint can be considered safe.

With temperatures at or below 0°C/32°F beware of ice on the surface, which will hinder the adhesion, and use a capacitive RH-meter for measuring the relative humidity.

In confined spaces, supply an adequate amount of fresh air during application and drying to assist the evaporation of solvent. All surfaces must be ventilated. However, avoid ventilators blowing directly onto the freshly applied paint.

As an adequate ventilation following figures are indicative:

Size of tank painted	Number of air shifts per hour during application and the first few hours thereafter
100 m³/3500 cbft	40
400 m³/14000 cbft	20
1000 m³/35000 cbft	15
4000 m³/140000 cbft	5

For the remaining period until full curing, an air shift of 1-2 time per hour is sufficient, however, depending on dehumidifier capacity.

The above figures describe what is necessary for the drying of the paint. **Precautions in order to avoid explosion risks may demand a stronger ventilation** (to be controlled by using a gas detector).

One litre undiluted HEMPEL'S GALVOSIL 1570 gives off in total 188 litres solvent **vapour** until it is completely dry.

The lower explosive limit, LEL, is 0.5%.

Solvent gasses of one litre GALVOSIL 1570 are thus to be "diluted" with approximately 380 m³ of air to keep usual safety limits.

It is noted that solvent vapours are heavier than atmospheric air. Therefore, effective ventilation means forced ventilation with exhaust from the lowest parts of the tank.

It is recommended to keep the relative humidity low during application and drying. Thereafter, let the relative humidity raise by "natural means", i.e. the dehumidifiers are notched off and normal ventilation used. However, it is recommended to let dehumidifiers run until dry film thicknesses have been checked - and if needed - rectified by an extra paint application.

Curing time:

Curing is dependent on (steel) temperatures and relative humidities.

At 20°C/68°F and 65-75% RH, curing requires approximately 3 days. At lower temperatures and relative humidity, curing time will increase considerably. Please contact Hempel for further instructions.

The relative humidity should be minimum 65% - and the minimum temperature -10°C/14°F - during the period of curing. Hosing down of tanks can support curing, but should if possible await the state of "near to complete" curing - please see below.

The coating will resist light showers after 1-2 hours at 20°C/68°F and 75% relative humidity. Curing may be promoted at low humidity by hosing down the surface with water 4 hours after application and keeping the surface constantly wet until curing is complete. If salt water is used, rinse with fresh water if the surface is to be overcoated.

State of curing:

Can be checked by rubbing the coating with a rag soaked in THINNER 0870. If the coating remains unaffected, the curing is "**near to complete**" (and sufficient for recoating).

Full curing for cargo loading:

Before tanks are taken into use, the coating must be completely through-cured. This is secured by low pressure hosing/washing the tanks with (fresh) water 2-3 times after the above described condition of "near to complete curing" has been obtained. By using the tank washing equipment, the normal ½ hour cycle is applied with half a day to one day between washings. Let the tanks remain wet between the washing.

Full curing is confirmed by rubbing the coating with methyl ethyl ketone.

The coating will now be fully resistant according to the **CARGO PROTECTION GUIDE**, but as long as the porosities are not yet filled with zinc salts, absorption of cargoes will take place, maybe making cleaning more difficult.

Curing may also be checked by scraping with e.g. a knife or a coin which shall produce a bright mark leaving some loosened zinc dust but no irregular detachment.

Full hardness will be obtained after weathering for some time.

Recommended film thickness:

For long time protection, **with topcoat:**

50 micron/2 mils dry; 75 micron/3 mils wet, (undiluted).

For long time protection, **without topcoat:**

75-100 micron/3-4 mils dry; 125-150 micron/5-6 mils wet, (undiluted).

In tanks: 100 micron/4 mils dry; 150 micron/6 mils wet, (undiluted), may be specified.

For a tank coating specification the film thickness must obey the 80-20 rule, ie 80% of the dry film thickness measurements must be equal to or greater than the specified film thickness (100 micron/4 mils) and of those below the specified film thickness, no measurements must be lower than 80% of the 100 micron/4 mils.

Too high dry film thickness, ie above approximately 150 micron/6 mils dry, should be avoided due to the risk of mud cracking or peeling. Please observe that according to accepted rules of measuring "a measurement" is to be the mean of three single point measurements taken in a close vicinity.

Note: Special care is necessary to ensure proper film thickness on welding seams, edges, corners, ribs, etc.

Extra coat:

Too low film thickness can be made good by applying an extra coat of HEMPEL'S GALVOSIL 1570. Surface preparation procedure - if necessary - and dilution of paint according to page 4 "Application procedure, tank coating".

The maximum interval for applying an extra coat is 7 days **provided** that the relative humidity is kept below 60%, absolute maximum is 65%, all the time until recoating and that the painted surface is not exposed to open weather, contamination of the like.

Spreading rate:

Theoretical (on a smooth surface):

dft, micron	dft, mils	m ² /litre	sq.ft./US gallon
50	2	12.8	513
75	3	8.5	342
100	4	6.4	257

Practical (with a consumption factor of 1.8):

dft, micron	dft, mils	m ² /litre	sq.ft./US gallon
50	2	7.1	285
75	3	4.7	190
100	4	3.6	143

Recoating interval:	<p>GALVOSIL 1570 must be fully cured before recoating with a full paint system. By recoating with sealer in 25 micron/1 mil only, the interval can be reduced to eg 24 hours at 20°C/68°F and 65-75% RH provided that the following coats are applied after HEMPEL'S GALVOSIL 1570 is fully cured.</p>
Topcoating procedure:	<p>Non-weathered zinc silicate coatings are porous and popping may occur in the subsequent coat(s).</p> <p>One way to reduce the risk of popping is to apply a mist coat as the first pass of the subsequent coat, let the air escape, and then apply the remainder of the topcoat.</p> <p>Some of HEMPEL's products will substantially reduce the risk of popping when applied directly on top of the zinc silicate. Refer to the product data sheets for HEMPEL'S SHOPPRIMER E 1528 and HEMPADUR HI-BUILD 4523.</p> <p>Advanced paint systems are recommended for topcoating, e.g. HEMPADUR qualities.</p>
Surface cleaning:	<p>The cleaning before topcoating depends on the condition of the surface:</p> <ol style="list-style-type: none"> 1. Intact zinc silicate surface with sporadic formation of "white rust" (zinc corrosion products). <ol style="list-style-type: none"> a. Remove oil, grease, dirt, etc. by detergent wash. b. Remove "white rust" by high pressure fresh water cleaning 200-350 bar (2900-5000 psi) at a nozzle-to-surface distance of 15-20 cm (6-8"). <p>If the surface is only slightly contaminated, corresponding to 1-2 months of exposure in a mildly corrosive environment, hosing down of the surface with fresh water and scrubbing with stiff brushes (nylon) may be sufficient and more practical. Check that the coating is through dry before recoating.</p> 2. Zinc silicate surface with extreme formation of "white rust" which cannot be removed as described above. <ol style="list-style-type: none"> a. Remove oil, grease, dirt, etc. by detergent wash. b. Abrasive blast sweep to remove "white rust", followed by vacuum cleaning to remove abrasives and dust. c. Restore the zinc layer with any solvent borne GALVOSIL quality, HEMPADUR ZINC 1536, or HEMPEL'S ZINC PRIMER 1649. 3. Damaged areas, burns, weld spatters, etc. <ol style="list-style-type: none"> a. Remove oil, grease, dirt, etc. by detergent wash. b. Remove weld spatters. c. Abrasive blasting to min. Sa 2½, followed by thorough removal of abrasives and dust by vacuum cleaning. d. Restore the zinc layer with any solvent borne GALVOSIL quality, HEMPADUR ZINC 1536, or HEMPEL'S ZINC PRIMER 1649.

Safety:

Keep away from open flame and sparks. Protect the ZINC DUST against moisture. Use with adequate ventilation. In confined areas, observe the usual precautions to prevent fire and damage to health. Use air masks, safety goggles, and workinggloves. In case of contact with eyes, rinse immediately with plenty of water and seek medical advice. After contact with skin, wash immediately with plenty of (liquid) soap and water.

This Product Data Sheet supersedes those previously issued. For definition and scope, see explanatory notes to applicable Product Data Sheets.

Data, specifications, directions and recommendations given in this data sheet represent only test results or experience obtained under controlled or specially defined circumstances. Their accuracy, completeness or appropriateness under the actual conditions of any intended use of the Products herein must be determined exclusively by the Buyer and/or User. The Products are supplied and all technical assistance is given subject to HEMPEL's GENERAL CONDITIONS OF SALES, DELIVERY AND SERVICE, unless otherwise expressly agreed in writing. The Manufacturer and Seller disclaim, and Buyer and/or User waive all claims involving, any liability, including but not limited to negligence, except as expressed in said GENERAL CONDITIONS for all results, injury or direct or consequential losses or damages arising from the use of the Products as recommended above, on the overleaf or otherwise. Product data are subject to change without notice and become void five years from the date of issue.

Issued by HEMPEL'S MARINE PAINTS A/S.

*This is a corporate trademark of the Hempel Group.

1570019840CO025

Issued:

September 1997/15700 - Page 8 of 8